Transaction No.: 2012433/5

28 Ignition swice cannot be turned on; key may stick in ignition; engine will not start

Release date: May 6,

2009

Condition

REVISION HI	STORY	
Revision	Date	Purpose
5	-	Revised Warranty
4	1/20/2009	Revised Title
3	11/25/2008	Revised Title to include Repair Group

- Engine will not start.
- Ignition cannot be turned on.
- In some cases, the ignition key cannot be removed from the ignition switch after attempting to start the engine.

Technical Background

No communication with the Access/Start Control Unit (J518), which may be caused by capacitor and or transistor damage within the Access/Start Control Unit (J518).

Production Solution

Introduction of an improved Access/Start Control Unit (J518).

Service

- Verify that the wire connections are good at the Access/Start Control Unit (J518), and verify voltage supply and grounds are OK.

 Remove the plack/red wire from position 19 of the Control Unit (J518), and Access/Start Control Unit (J518), and verify voltage supply and grounds are OK.
- Access/Start Control Unit (J518).



Note:

This wire provincs the signal (50) from the starter relay. Removal of this circuit is to prevent a possible voltage spike that could cause damage to the Access/Start Control Unit (J518).

Tape the wire and terminal back on the wiring harness.

Replace the Access/Start Control Unit (J518).

Warranty

	T			
Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical			
	Service Bulletin is informational only.			
Service Number:	9668			
Damage Code:	0040 FC C			
Labor	Replace Immobilizer Control Unit	9668 55 00	160 TU	
Operations:	Since			
Diagnostic Time:	GFF - Key adaptation	0150 9999	20 TU	
	Road test prior to service procedure	No allowance	0 TU	
	Road test after service procedure	No allowance	0 TU	
	Technical diagnosis at dealer's discretion			
	(Refer to Section 2:2.1.2 and Audi Warranty Online for DADP allowance			
	details)			
Claim	As per 1SB #2012483/5			
Comment:	OK		ODE	

All warranty plaims submitted for payment must be in accordance with the Audi Warranty Policies and Procedures Manual. Claims are subject to review or audit by and Warranty.

http://www.smattpDFCreator.com

Additional Information

All parts and service references provided in this TSB are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.

©2009 Audi of America, Inc.All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher. Nttp://www.SmartpDF.Creator.com

http://www.smarthplifcreation.com