

Audi Workshop Manuals

AdChoices

[PREV PAGE] [NEXT PAGE]



A8 Quattro Sedan V8-4.2L (BFM) (2005)









Search Privacy Policy

Donate and help keep workshop manuals freely available.

Donate VISA VISA BIRECT

Other Audi Workshop Manuals Other Makes

Bump Stop Trunk Sill

Figure 9. Side cross section of trunk lid closed and bump stop impacting the trunk loading sill.

1. Adjust the height of the new https://doi.org/10.108/j.jeps.105. Using your hand, turn the bump stop counterclockwise until it rests on the trunk loading sill when the https://doi.org/10.108/j.jeps.105. Using your hand, turn the bump stop counterclockwise until it rests on the trunk loading sill when the https://doi.org/10.108/j.jeps.105. Using your hand, turn the bump stop counterclockwise until it rests on the trunk loading sill when the https://doi.org/10.108/j.jeps.105. It is a superclockwise until it rests on the trunk loading sill when the https://doi.org/10.108. It is a superclockwise until it rests on the trunk loading sill when the https://doi.org/10.108. It is a superclockwise until it rests on the trunk loading sill when the https://doi.org/10.108. It is a superclockwise until it rests on the trunk loading sill when the https://doi.org/10.108. It is a superclockwise until it rests on the trunk loading sill when the https://doi.org/10.108. It is a superclockwise until it rests on the trunk loading sill when the https://doi.org/10.108. It is a superclockwise until it rests on the trunk loading sill when the https://doi.org/10.108. It is a superclockwise until it rests on the trunk loading sill when the https://doi.org/10.108. It is a superclockwise until it rests on the trunk loading sill when the https://doi.org/10.108. It is a superclockwise until it is a superclockwise until it is a su

Tip: It may be easier to adjust the height of the bump stop if the spring-loaded pin is depressed and rubber cover is removed, but it is not necessary. Always reinstall the rubber cover when checking the height adjustment against the trunk sill.

- 2. Repeat for remaining side.
- 3. Test the functionality of the rear trunk lid. Ensure it is within all normal operating $\underline{\text{specifications}}$

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.			
Service Number:	5559			
Damage Code:	0012, 0011			
Labor Operations:	Repair trunk mounted bump stops	5559 9999	20 TU	
Diagnostic Time:	GFF	0150 0000	10 TU	
	Road test prior to service procedure	No allowance	0 TU	
	Road test after service procedure	No allowance	0 TU	
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)			
Claim Comment:	As per TSB #2019840/3			
All warranty claims submitted for payment must be in accordance with the Audi Warranty Policies and Procedures Manual. Claims are subject to review or audit by Audi Warranty.				

WARRANTY INFORMATION

Part Number	Part Description	Quantity
8H0 827 249 A	Adjustable Buffer	2

ADDITIONAL INFORMATION

All parts and service references provided in this TSB are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.

Free car repair manuals Repair Manual Latest it news Spyware Removal Car repair manual Latest movies on dvd <u>Latest News</u> <u>Parts and service</u> <u>Symptoms of depression</u> <u>Manual</u> <u>Free car repair manuals</u> <u>Repair Manual</u> infolinks

[PREV PAGE] [NEXT PAGE]

1 of 1 2/18/2015 11:36 PM