 


# Technical Service Bulletin



Audi

## 91 Sound cuts out above 6 mph with Audi concert radio and without Bang & Olufsen

91 14 25 2032966/5 February 13, 2014. Supersedes Technical Service Bulletin Group 91 number 13-00 dated August 13, 2013 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4	2013	All	Audi concert radio without Bang & Olufsen
A5	2013		
Q5	2013		

## Condition

REVISION HISTORY		
Revision	Date	Purpose
5	-	Revised title Revised <i>Service</i> (Updated step 1) Revised <i>Warranty</i> (Updated TUs for GFF)
4	8/13/13	Revised <i>Service</i> (Updated step 7)
3	3/29/13	Revised <i>Service</i> (added SVM action code) Revised title
2	3/7/13	Revised <i>Service</i> (added procedure steps)
1	2/7/13	Original publication

- There is no sound (from all audio sources) when vehicle is operated above 6 to 10 mph. When the ignition is cycled and the vehicle is stationary, the audio will work until the vehicle is driven again.
- Only vehicles with Audi concert radio (PR **8UQ**) and standard sound system (PR **9VD**) are affected.

## Technical Background

Not applicable.

## Production Solution

Not applicable.