

Account

Vehicle

Help

Search

Contact

AutoZone Community

Exit

Your Vehicle: 2010 Audi Q7 Quattro (4LB) V6-3.0L DSL Turbo (CATA)



SAVE \$25
instantly on 4 tires!

tirebuyer.com

SAVE NOW >

SAVE \$25
instantly on 4 tires!

tirebuyer.com

SAVE NOW >

[Vehicle](#) » [Technical Service Bulletins](#) » [All Technical Service Bulletins](#) » [Body - Sun Roof Various Squeaks and Rattles](#)

Body - Sun Roof Various Squeaks and Rattles

70 Noises from [headliner](#) / sunroof area

70 15 48

2038029/4

October 14, 2015

Supersedes Technical Service Bulletin Group 70 number 15-47 dated September 21, 2015 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A3, Q3	2015 - 2017	All	Not Applicable
A4, allroad, A8	2010 - 2017	All	Not Applicable
Q5	2010 - 2016	All	Not Applicable
Q7	2010 - 2015	All	Not Applicable

Zoom

Sized for Print

Vehicle Information

REVISION HISTORY		
Revision	Date	Purpose
4	-	Revised header data (Updated model codes)
3	9/21/2015	Revised <i>Required Parts and Tools</i> (Updated to more durable material)
2	2/25/2015	Revised header data (Added Q3) Revised <i>Warranty</i> (Added Q3)

Various squeaks and/or rattles are heard from the roof area on vehicles equipped with a panoramic sunroof.

Zoom

Sized for Print

Condition

Technical Background

These noises can be created by the points of contact between the sunroof cover trim frame and the clips that retain it to the headliner.

Production Solution

Not applicable.

Service



Figure 1: Unclipping the sunroof cover trim frame.

Zoom

Sized for Print

1. Remove the glass sliding roof panel(s). Remove the beam for the sunroof rollershade. Carefully unclip and remove the sunroof cover trim frame (Figure 1).

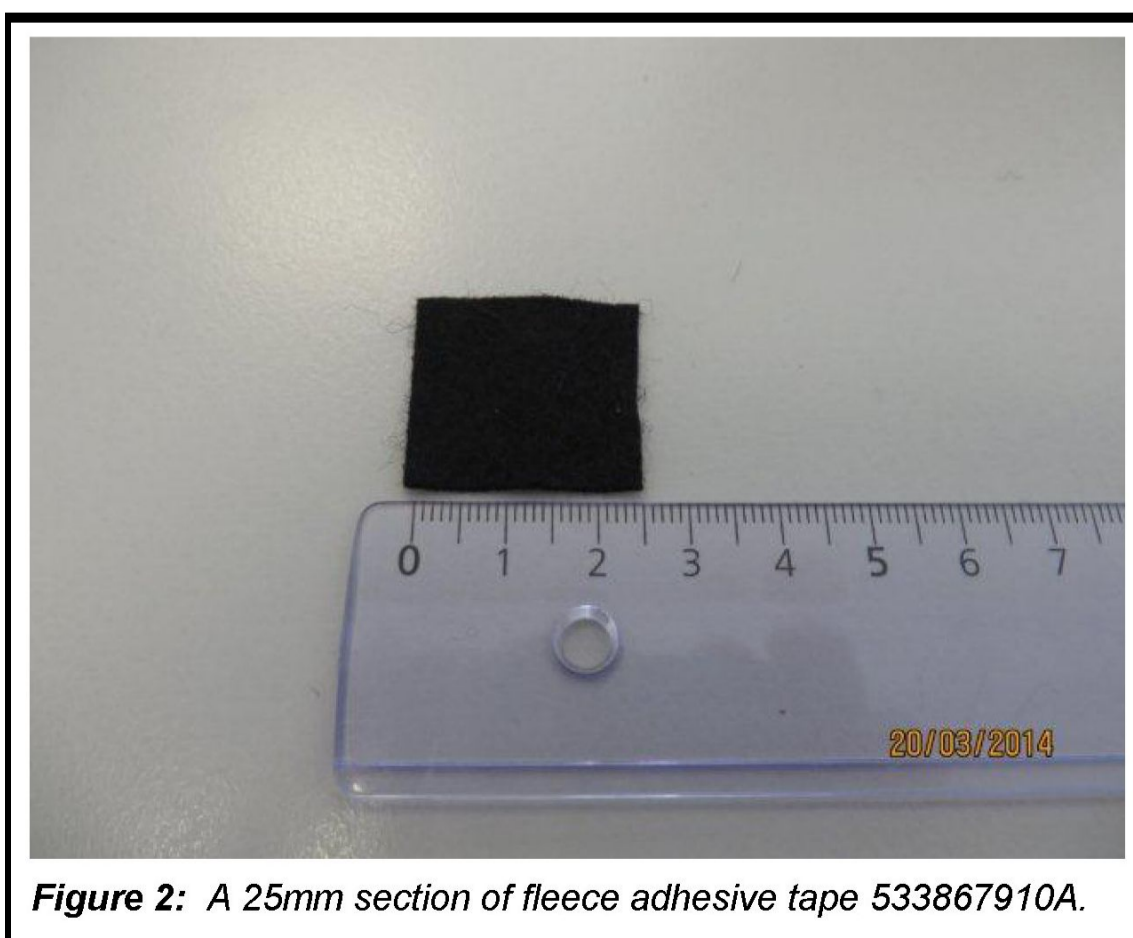


Figure 2: A 25mm section of fleece adhesive tape 533867910A.

Zoom

Sized for Print

2. The number of retaining clips will vary by model. A piece of dampening tape (fleece adhesive tape 533867910A) will be applied to each clipping point. Cut pieces of the tape 25mm long (Figure 2).



Figure 3: Fleece tape section applied.



Figure 4: Retaining clip isolated with the fleece tape.

Zoom

Sized for Print

3. Apply the sections of fleece tape to the sunroof cover trim frame to each clipping point as shown (Figure 3 and Figure 4).

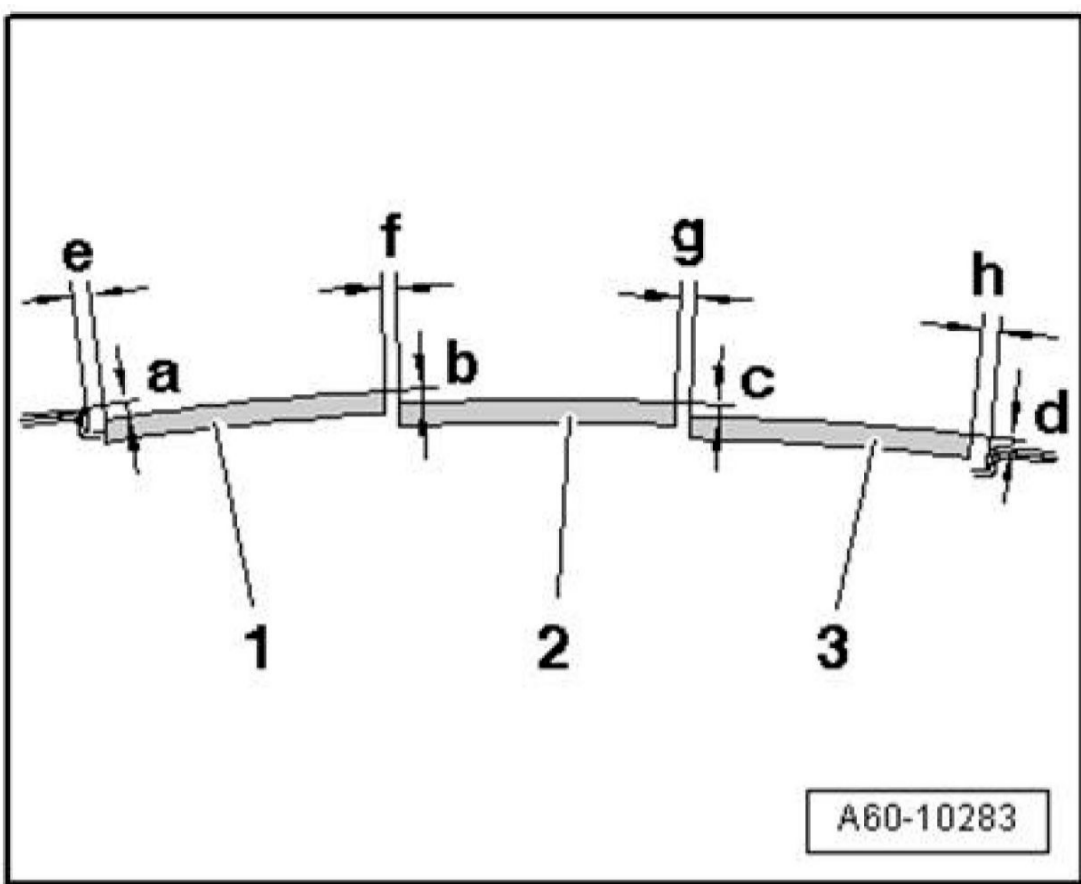


Figure 5: Adjustment of the glass sliding roof panels.

Zoom

Sized for Print

4. Reassemble the components removed for this modification. Ensure that the glass sliding roof panels are adjusted properly according to the repair manual (Figure 5).

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	7084		
Damage Code:	0020		
Labor Operations:	A8L:		
	Sunroof sunshade remove and reinstall (includes removal and reinstallation of the glass tilting roof panels)	6070 1900	90 TU
	Sunroof cover trim frame remove and reinstall and apply fleece adhesive tape	7084 9999	20 TU
	Q7:		
	Front glass tilting roof panel remove and reinstall	6039 1900	40 TU
	Center glass tilting roof panel remove and reinstall	6041 1952	40 TU
	Rear glass tilting roof panel remove and reinstall	6039 1902	50 TU
	Front and rear sunshade beams loosen and fasten	6070 9999	40 TU
	Sunroof cover trim frame remove and reinstall and apply fleece adhesive tape	7084 9999	20 TU
	A4 Avant/allroad:		
	Front glass tilting roof panel remove and reinstall	6039 1910	40 TU
	Rear glass tilting roof panel remove and reinstall	6041 1910	30 TU
	Sunshade beam loosen and fasten	6070 9999	30 TU
	Sunroof cover trim frame remove and reinstall and apply fleece adhesive tape	7084 9999	20 TU

Zoom

Sized for Print

	Q5:		
	Front glass tilting roof panel remove and reinstall	6039 1900	40 TU
	Rear glass tilting roof panel remove and reinstall	6039 1902	50 TU
	Sunshade beam loosen and fasten	6070 9999	30 TU
	Sunroof cover trim frame remove and reinstall and apply fleece adhesive tape	7085 9999	20 TU
	Q3:		
	Front glass tilting roof panel remove and reinstall	6039 1900	40 TU
	Rear glass tilting roof panel remove and reinstall	6041 1910	30 TU
	Sunshade beam loosen and fasten	6070 9999	30 TU
	Sunroof cover trim frame remove and reinstall and apply fleece adhesive tape	7084 9999	20 TU
	A3 sedan:		
	Glass tilting roof panel remove and reinstall	6039 1900	30 TU
	Sunshade remove and reinstall	6070 1950	30 TU
	Sunroof cover trim frame remove and reinstall and apply fleece adhesive tape	7084 9999	30 TU
Diagnostic Time:	GFF	No allowance	0 TU
	Road test prior to service procedure	0121 0002	10 TU
	Road test after service procedure	0121 0004	10 TU
	Technical diagnosis at dealer's discretion. (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details.)		
Claim Comment:	As per TSB #2038029/4		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Zoom

Sized for Print

Warranty

Part Number	Part Description	Quantity
533867910A	 Fleece Adhesive Tape	2

Zoom

Sized for Print

Required Parts and Tools

Additional Information

All parts and service references provided in this TSB (2038029) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.

