

Colin Willis

From: Botelho, Michael <michael.botelho@vw.ca>
Sent: March-16-16 2:44 PM
To: Colin Willis
Cc: Ireland, Greg; Schnuelle, Ingo
Subject: Ticket 1558403_WAUF2CFC5DN089092_4993201

Hi Colin,

As per our discussion, please perform the following:


1. Replace both turbo's ✓
2. Replace the PCV valve ✓
3. Replace both intake manifolds ✓
4. Replace the pistons ✓
5. Replace the spark plugs ✓
6. Change the oil and filter ✓
7. Clean out the turbo oil lines
8. Clean out the intercooler housing
9. Prime the engine before starting (disconnect the crank sensor and crank the engine over)
10. Also replace components 1-4 below as per Elsa.

#1 o-ring comes with #2

#2 brass one way check valve 079103175C (comes with o-ring #1)

#3 oil screen 079115175F

#4 breather gasket as per vin.

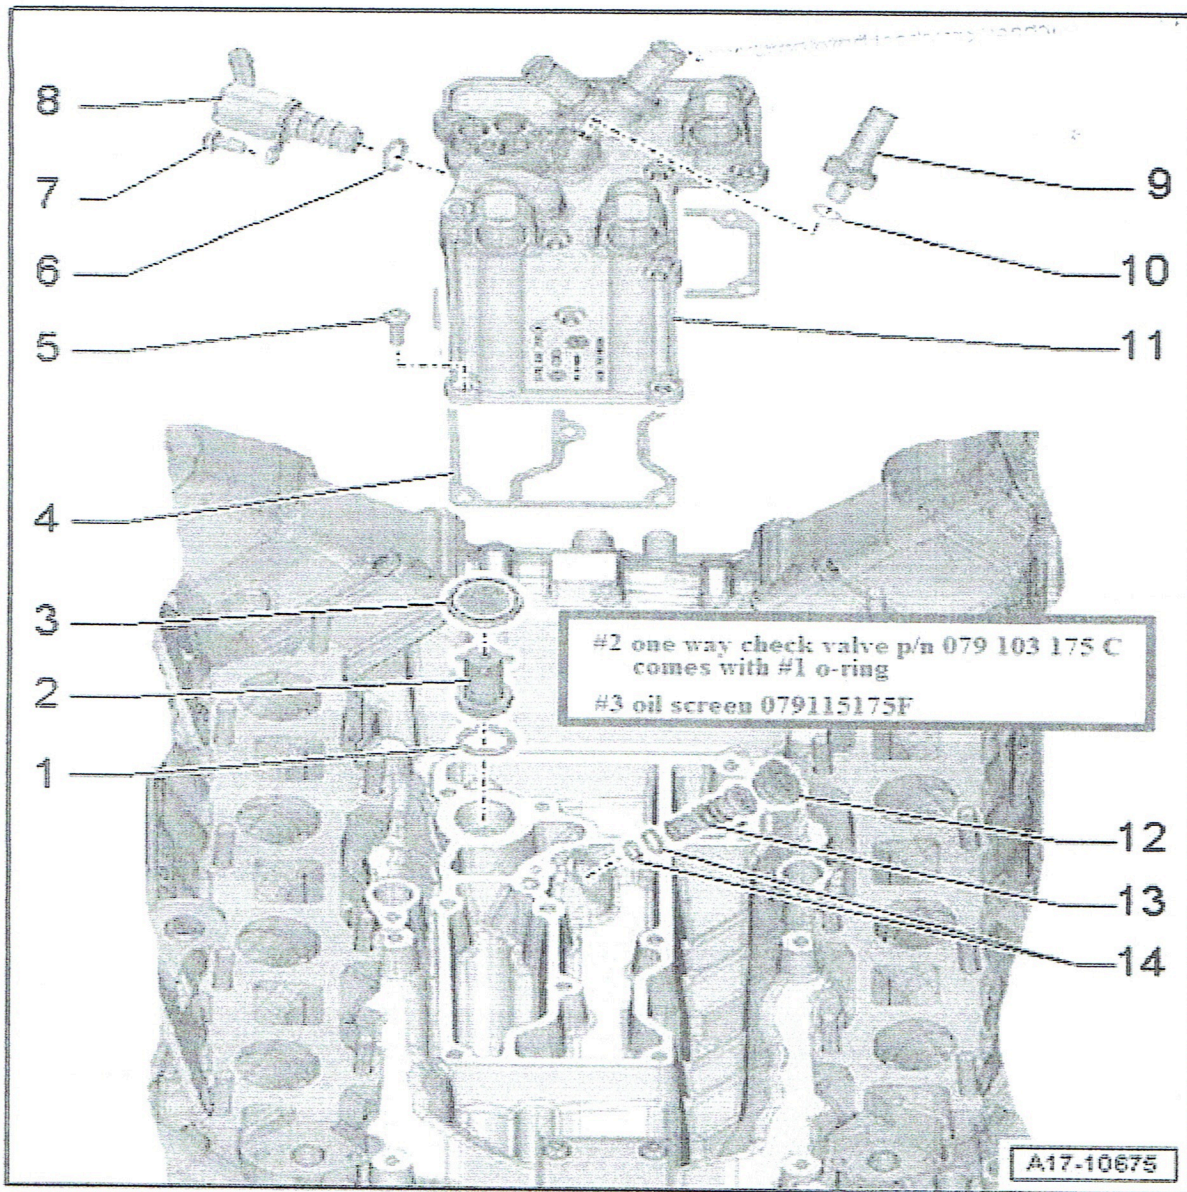

Can you please package all the old parts and send them in to my attention? if there is any debris on the oil screen, please preserve it as best you can and place it in a plastic bag.

If you see anything else worth noting during the repair, please let us know. Thanks for your help.

Greg, can you please update the ticket accordingly?

Thanks

Michael Botelho

Product Support Analyst, Technical Services
Group After Sales

Volkswagen Group Canada Inc.
777 Bayly St W.
Ajax Ontario
Canada
L1S 7G7