

Account

Vehicle

Help

Search

Contact

AutoZone Community

Exit

Your Vehicle: 2010 Audi Q7 Quattro (4LB) V6-3.0L DSL Turbo (CATA)



SAVE \$25
instantly on 4 tires!



SAVE NOW >

SAVE \$25
instantly on 4 tires!



SAVE NOW >

[Vehicle](#) » [Technical Service Bulletins](#) » [All Technical Service Bulletins](#) » [Engine - Coolant Identification](#)

Engine - Coolant Identification

19 Identifying and mixing factory fill engine coolants

19 15 62

2025303/6

September 8, 2015

Supersedes Technical Service Bulletin Group 19 number 15-61 dated July 7, 2015 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
All	1994 - 2018	All	Not Applicable

Zoom

Sized for Print

Vehicle Information

REVISION HISTORY		
Revision	Date	Purpose
6	-	Revised <i>Service</i> (Added information about reusing coolant)
5	7/7/2015	Revised header data (Added model years)
4	6/20/2014	Revised header data (Added model year)

Discontinuation and mixing of Audi-approved engine coolants.

Zoom

Sized for Print

Condition

Technical Background

^G11, G12, and G12+ coolants have been replaced by an improved version.

^ G12++ coolant (for service available) has been introduced in MY 2005 for all engines.


^ G13 has been introduced in MY 2008 as factory filling and service.

Production Solution

No production change required.

Service

Identifying and mixing factory fill engine coolants

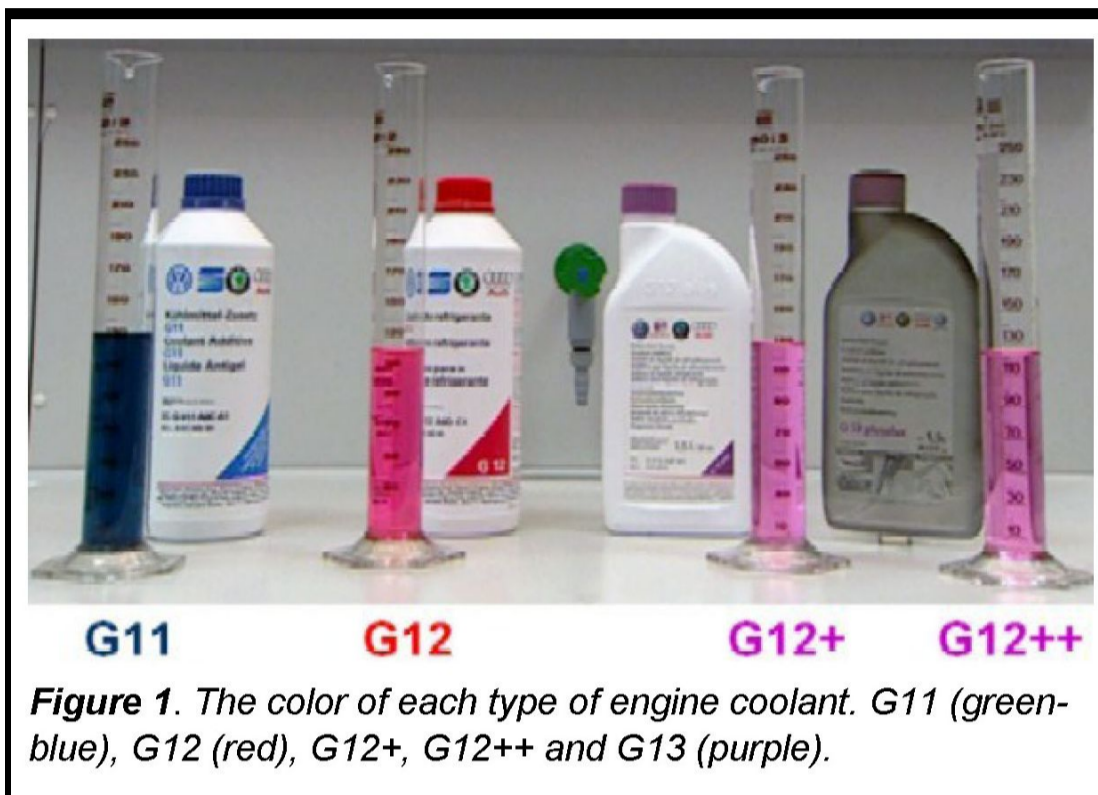

Zoom Sized for Print

1. Based on its color, identify which coolant the vehicle was filled with from the factory (Figure 1).

Tip: Figure 1 is shown for color identification only; coolant packaging may vary.

		Factory Filling				
Can be mixed with ...		green-blue G11 ≥ 1994	red G12 ≥ 1996	purple G12+ ≥ 2000	purple G12++ ≥ 2005	purple G13 ≥ 2008
G11	←	Green	Red	Red	Red	Red
G12	↓	Red	Green	Red	Red	Red
G12+		Green	Green	Green	Red	Red
G12++		Green	Green	Green	Green	Green
G13		Green	Green	Green	Green	Green

Figure 2. The table identifies which Service coolants (left) can be added to the Factory Filled coolant (top).

Zoom Sized for Print

2. Using the chart at right, determine if the vehicle has the correct coolant (Figure 2). If a vehicle is found to have the incorrect coolant, drain and fill the coolant system using the repair manual procedures in Elsa.

Note :Coolants can be mixed, as described in the chart, but it is always best practice to change the coolant due to reduced corrosion protection when coolants are mixed (exception: G12++ and G13 are fully compatible).

Only use distilled water for mixing coolant.

Drained coolant must not be reused.

Note :When the coolant is changed due to a cooling system issue, the cooling system should be drained using the repair manual procedures in Elsa and refilled with water and the engine run for 15 minutes with the heater on to remove any residual coolant. Then drain and fill the system to the freeze protection ratio listed in Elsa.

Tip: Cooling system drain and fill due to coolant mixing, or incorrect coolant, is not covered by warranty.

Warranty

This TSB is informational only and not applicable to any Audi warranty.

Required Parts and Tools

No special tools required.

Additional Information

All part and service references provided in this Technical Bulletin (2025303) are subject to change and/or removal. Always check with your Parts Department and Repair Manuals for the latest information.

[Account](#) | [Vehicle](#) | [Help](#) | [Contact](#) | [AutoZone Community](#) | [Exit](#)

© 2016 ALLDATA, LLC. All Rights Reserved. [Trademarks](#) | [Privacy Policy](#) | [Terms and Conditions](#)